

1451Z 20 FEB 65

SECRET

DIRECTOR

25X1A

FROM:

[REDACTED]

INFO:

INFO:

PRIORITY

FOR: 1451Z 20 FEB 65

IN 73031

SECRET

25X1A

PRIORITY

INFO PRIORITY

7717 25X1A

25X1A

[REDACTED]

25X1A

A. C045C

B.

[REDACTED]

C. MOD 111/4-DS-250/60"/82 DEG F/20 FEB

D. 9L-2.00/1.90/9R-1.99/2.00

E. 4401/9L-52-22-8-4/9R-47-22-7-4

F. (1) UNPROCESSED

2. GOOD

3. GOOD

4. FAIR

5. FAIR

6. FAIR

7. FAIR

G. REMARKS:

CAMERA MALFUNCTIONS:

1. 9L FILM METERING BETWEEN FRAMES 0001 AND 0002 - POOR.

REMAINING PART OF ROLLS FAIR.

25X1A



7717 (IN 73031)

S E C R E T

PAGE TWO

2. VACUUM FAILURE ON FRAME 0227 - BOTH 9L AND 9 R. BOTH FRAMES BLURRED.

3. CAMERA STATIC ON 9R ONLY, APPEARS TO BE BURSTING APPROX EVERY 1 INCH ALONG BOTH EDGES OF FILM AND INTO FRAME 1 INCH - STARTS AT HEAD END OF ROLL AND CONTINUES THROUGH TO THE TAIL. A MINUS DENSITY SPOT APPEARS ON THE 9L ROLL EVERY 1 3/4 INCHES, AND IS LOCATED 2 3/4 INCHES IN FROM THE CLOCK EDGE.

4. A PLUS DENSITY LINE, 1/32 INCHES WIDE, LOCATED 3 3/8 INCHES IN FROM THE OUTBOARD EDGE ON PARTS 1 - 2 - 3 ONLY, ON THE 9R ROLL.

5. PROCESSING PINHOLES ON 9L, FRAMES 0371, 0523, 0522, 0521, 0519, 0517, 0514, 0512, 0409, 0425, 0447, 0453, 0455, 0450, 0459, 0463, 0471, 0473, 0479, 0486, 0492, 0508, 0569, 0577, 0529, 0536, 0546, 0554, 1213, 1233, 1448. PROCESSING PIN HOLES ON 9R, FRAMES 0103, 0404, 0412, 0483, 0491, 0496, 0500, 0515, 0516, 0518, 0522, 0525. REASON UNKNOWN AT THIS TIME.

6. CINCH MARKS 9L, FRAMES 0528, 0550, 1263, 1674, 2083. CINCH MARKS 9R, FRAMES 0284, 0285, 0292, 0293, 0535, 0536, 0661, 0795, 0807, 0808, 1060, 1061, 1221, 1222, 1416, 1462, 1480, 1593, 1726. CAUSE BY INSPECTORS DURING BREAKDOWN ON 0° NEG.

7. FRAME 0032 ONE SMEAR CAUSED BY A MOSQUITO WRAPPED UP IN ROLL DURING PROCESSING OF 9L.

H. 0° NEG TO  2000 FEB 20, 1965.

25X1A

END OF MSG

S E C R E T